

# Technical Bulletin



2335 208TH ST • TORRANCE, CA 90501 • (310) 328-1306 • FAX (310) 328-0869

<b>DATE:</b> 6/7/96	<b>PRODUCT:</b> All CD Jukeboxes with S-6 Computers and CDM12 Players (Production Dates: 4/95 thru 3/96)	<b>NO:</b> 5021
---------------------	--	-----------------

<u>Model</u>	<u>Serial Numbers</u>
6000-1 Anniv. Legend	851910640913 - 261920920912
5500-1 Rocket II	152910210800 - 261911950802
CD-8 Bubblers	651910640100 - 361915670100
CD-8 Bubblers Oak	751910020200 - 361910520200
CD-4CC Coca Cola	851910110404 - 960911140400
CD-4HD Harley Davidson	951910200500 - 361910890500
CD-4GZ Gazelle	152910040301 - 161910130300
CD-6PB Peacock	052910010700 - 261910230701

**SYMPTOM:** Compact Disc will intermittently be put down on to the player and will cancel without playing or spin briefly and then cancel.


**ACTION:** If you should experience the above symptom, contact our office to order **58535-6.5 Eprom** to correct the above symptom. The new Eprom will upon receiving a playing error cause the mechanism to reject the disc, scan around to the disc again and then retry it.

**IMPORTANT:** Dip switch #9 must be set on (FIFO) for this to work properly.

	OFF	ON	
Save Selections			<b>1</b> Clear Selections
CD Test (OFF)			<b>2</b> CD Test (ON)
Disable Random Play			<b>3</b> Enable Random Play
(OFF) Not used			<b>4</b> (OFF) Not used
Map All Slots			<b>5</b> Do Not Remap To Zero
60 Minute Song			<b>6</b> 5 Minute Song
Disable 95-99			<b>7</b> Enable 95-99 BGM
Disable Album Play			<b>8</b> Enable Album Play
Fast Selection			<b>9</b> FIFO Selection
Disable Auto Size			<b>10</b> Enable Auto Size

**INSTALLATION:** When installing a new Eprom, make sure the power to the jukebox is turned off. Remove the computer cover. Gently remove the old Eprom and replace with the new Eprom #58535-6.5. The RAM memory IC in space U22 must be removed and re-inserted to ensure them that the memory is cleared out.

**Note:** Make sure that you match the indents together identical to picture in Fig. B.

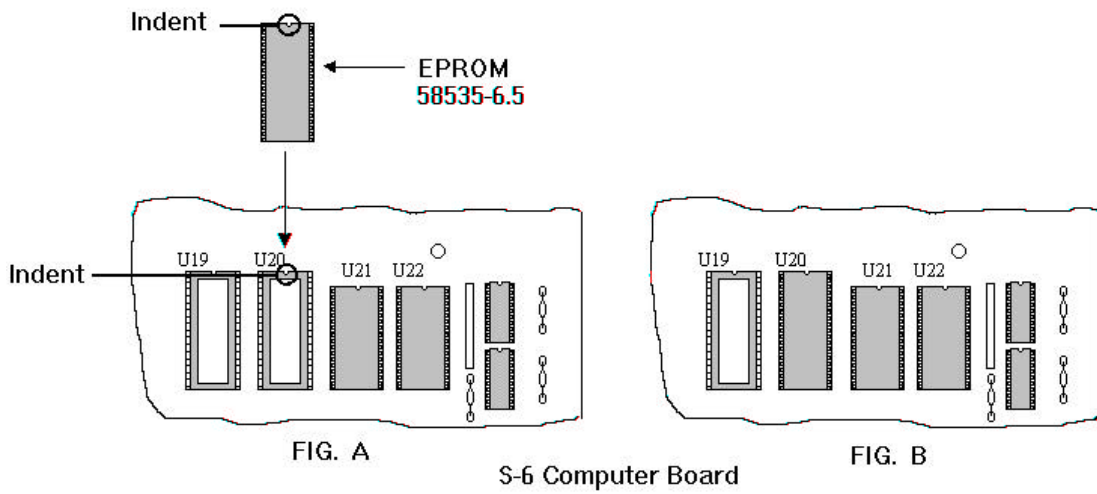

**NOTE:** To avoid invoice charges, please return old Eprom 58535-6.4 with return goods authorization number.